


Two-Sided Graphic Application on Glass

1




2

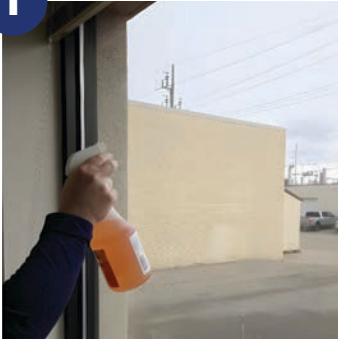


3




4

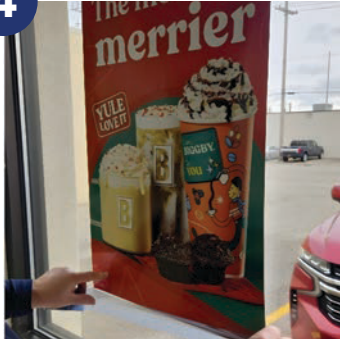

5

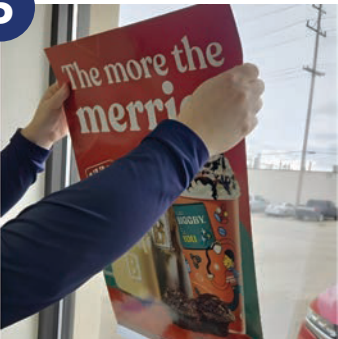

6

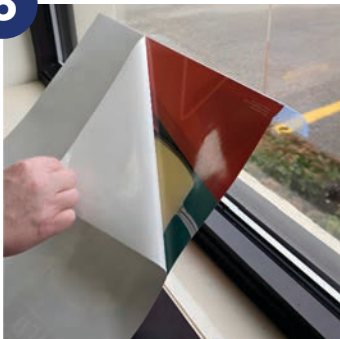


7



8



9

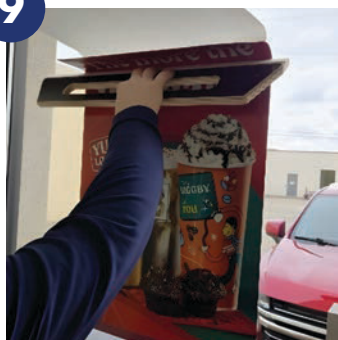

10



Where to Install

Inside application is the preferred method. An outside application is subject to temperature limitations. Minimum application temperature is 40° F if the decal can only be applied to the outside of the glass.

How to Prepare the Graphic

Keep the graphic as close to room temperature as possible before use. A cold graphic can curl or turn brittle.

How to Install

Prepare the surface properly by removing any old adhesive off of the window and cleaning with a soap and water mixture or 70/30 isopropyl alcohol mixture. Let the glass surface dry completely before application.

Dry apply method: Position the graphic and tape the top or bottom edge. Remove the liner either gradually or completely (depending on how large the graphic is) and squeegee from left to right in overlapping strokes, working your way through the entire graphic. After completing, be sure to go back over the entire graphic, especially paying close attention to the edges of the graphic.

Wet apply method: Lightly spray the glass and the graphic with a very light soap and mostly water mixture. Remove the liner, lightly spray the adhesive side of the graphic and then place on the window. The fluid will allow you to float and position the graphic where you need it. Once in place, be sure to work from top to bottom using overlapping squeegee (a soft edged squeegee is preferable to prevent scratches) strokes and making sure to force the water out from inside to out the edges. It is extremely important to get rid of all the fluid as it can create bubbles if left behind and could freeze in cold conditions.

Once the entire graphic is applied look for any air bubbles. Sometimes an air bubble is more obvious on the backside of the decal than the front side. Use the squeegee to push the air bubble to the nearest edge.